




DTH31

Digital Psychrometer

NEW POCKET-SIZED DESIGN MONITORS THREE PARAMETERS SIMULTANEOUSLY

- Triple Display
- Protective Sensor Cap
- Fast Response Time
- Features Include:
 - Ambient temperature (T1)
 - RH humidity
 - Dew Point
 - Wet Bulb
 - Hold
 - MIN/MAX
 - °C or °F switchable
 - External temperature (T2)*
 - T1 - T2 (Ambient - external temp)*
 - T2 - Dew point*

*Available with optional external probe

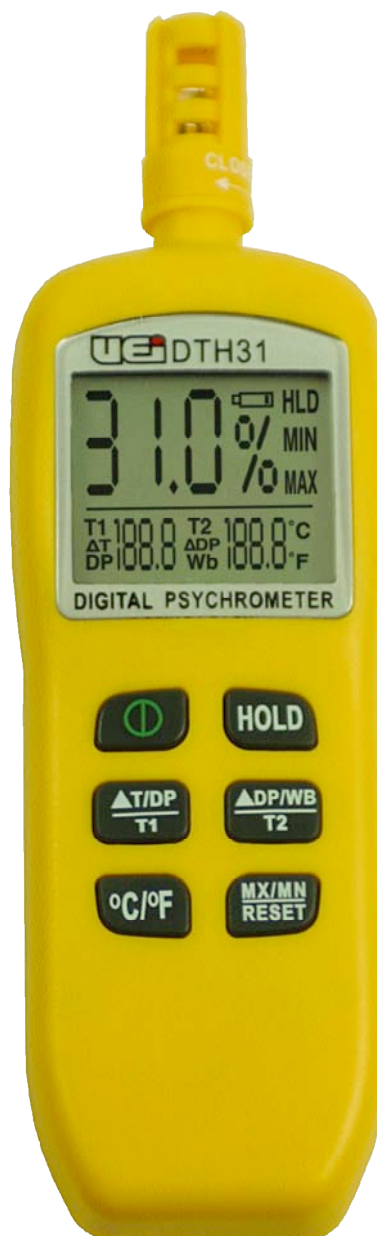

DTH31 • Digital Psychrometer

The DTH31 Digital Psychrometer is an advanced handheld humidity and temperature meter. Its triple display shows three parameter readings simultaneously. It has everything you need to charge an air-conditioning system and determine heating, cooling, and ventilation needs. It gives you incredibly fast and accurate wet bulb, dry bulb, and dew point measurements.

The DTH31 has the following features:

- Ambient temperature (T1)
- RH humidity
- Dew Point
- Wet Bulb
- Display resolution 0.1 °F/°C
- Protective sensor cap
- Sensor: Electronic capacitance polymer film
- Condensation will not affect accuracy
- Hold
- MIN/MAX
- °F or °C switchable
- Low battery indicator
- Pocket size design
- Reset
- Auto Off with by-pass
- One year limited warranty

With Optional Extended Probe

- External temperature (T2)*
- T1 - T2*
- T2 - Dew point (check difference of surface to dew point)*

Specifications

Temperature range	-4 to 122°F (-20 to +50°C)
RH% range	0 to 100% RH
Wet Bulb range	-69 to 122°F (-21.6 to 49.9°C)
Dew Point range	-90.4 to 122°F (-68 to 49.9°C)
External temperature range	-4 to 158°F (-20 to 70°C)
Accuracy	RH% = ±3% at 25°C
	Temperature = ±1°F (0.6°C)
Response time	60 seconds typical
Power	2 x 1.5 V AAA battery

Product Line Comparison

	DTH880	DTH10	DTH31
Design style	Wall mount	Pen style	Pocket size
Relative humidity	20 to 95%	5 to 95%	0 to 100%
Temp °F	32 to 122°	14 to 122°	-4 to 122°
Temp °C	0 to 50°	-10 to 50°	-20 to 50°
MIN/MAX	X	X	X
Hold	X	X	X
Auto Off		X	X
Wet Bulb			X
Dew Point			X
External temp w/probe			Optional
Auto Off by-pass			X
°F/°C switchable			X
Low battery indicator			X

Standard Accessories Included:

Batteries "AAA" Alkaline
Instruction Manual

Optional Accessories:

External Temperature ProbeATT31

Distributed By:



1-800-547-5740 • Fax: (503) 643-6322
www.ueiautomotive.com
Email: info@ueitest.com

IN CANADA

Vancouver: Phone: 1-877-475-0648 • (604) 278-4511 • Fax: (604) 278-8299
Toronto: Phone: 1-877-475-0648 • Fax: (905) 238-5117

IN EUROPE

Phone: +44 1707 375550 • Fax: +44 1707 393277

